

Operating Instructions STX-1 Series Digital Strap Tension Meter

TABLE OF CONTENTS

- 1. WARRANTY POLICY 3
- 2. SPECIFICATIONS 4
- 3. SAFETY AND MAINTENANCE 5
- 4. INSTRUMENT OPTIONS 6
 - Standard Instruments – Using Customer Material 6
 - Standard Instruments – Using Multiple Materials 6
 - Add-On Options..... 6
 - - A Analog Output option 6
 - - E RS-232 Serial Output option 6
 - Features of all Instruments 7
- 5. BASIC OPERATION 8
 - Charging Instrument Batteries 8
 - Quick Start Instructions 8
 - Engaging Instrument onto Strap 10
- 6. DISPLAY SCREENS 10
 - SETUP Screen 10
 - LCD Refresh Rate 10
 - Data Averaging 10
 - Custom Names 10
 - Re-Cal Tension: See description at the end of this booklet. 11
 - Audio 11
 - Backlight 11
 - Set-Point Menu 11
 - Version 12
 - DATA LOGGING Screen..... 12
 - View Data Stats 12
 - View Data Log..... 12
 - Clear Single Point Log 12
 - TENSION UNITS Screen..... 12

•	SELECT MATERIAL Screen	12
7.	ADVANCED OPERATION	13
•	General Calibration Precautions	13
•	Check Accuracy	13
•	Calibrate Instrument	13

Proprietary Notice

This document contains proprietary information which may not be reproduced in whole or in part without the written permission of Tensitron, 733 South Bowen Street, Longmont, CO 80501.

Tensitron reserves the right to make instrument changes and improvements which may not be reflected in this document. Portions of this document may have been updated to include the latest hardware or firmware version, if applicable. We recommend that this document be read in its entirety before any attempt is made to operate the instrument.

Thank You . . .

For purchasing another fine product from Tensitron

If you have any questions or need assistance, please call us at
303-702-1980 or find us online at www.tensitron.com

1. WARRANTY POLICY

STANDARD EQUIPMENT WARRANTY

Tensitron warrants that all Tensitron-manufactured equipment will be free of any defect in materials or workmanship for the period of (1) year. Warranty begins from the date of shipment from a Tensitron facility. The warranty is extended to customers and applies to all Tensitron-manufactured equipment purchased, installed, and used for the purpose for which such equipment was originally designed. The above warranties cover only defects arising under normal use and do not include malfunctions or failures resulting from misuse, abuse, neglect, alteration, problems with electrical power, usage not in accordance with product instructions, acts of nature, or improper installation or repairs made by anyone other than Tensitron or a Tensitron-authorized, third-party service provider. Shipping costs to and from Tensitron are not included in the warranty coverage.

2. SPECIFICATIONS


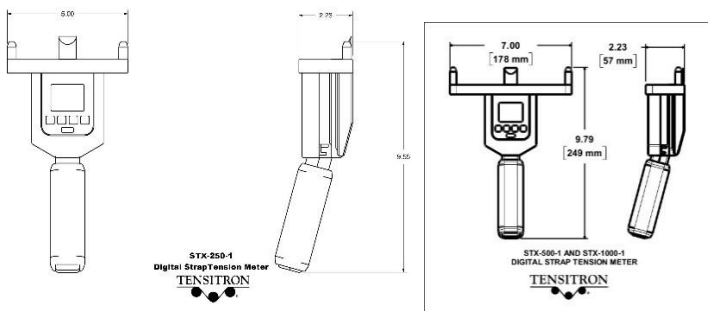


Figure 1: STX-1 Dimensions

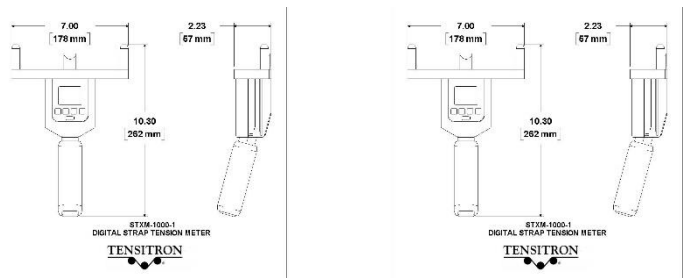

Full Scale Accuracy

For the accuracy of each STX-1 and STXM-1 unit, see the Table in Section 4.

STX-1 series instruments are calibrated specifically to your strapping type(s) and size(s) to ensure the greatest accuracy possible. When ordering, specify: material, width and thickness of the strap.

STXM-1 series instruments include multiple selections for different strapping. Models STXM-250-1 through STXM-1000-1 include multiple selections for Poly and PET strappings. The Model: STXM-2000-1 includes selections for both Steel, Poly and PET strappings.

Power Requirements

For Instrument Input: 9 VDC...2.2A
For AC Adapter: 100-240V~50-60Hz 0.48A
Power Supply operates with input voltages from 100 –240V and includes several interchangeable adapters allowing use with European, U.S., Australian, English and other plug configurations.

Battery: Rechargeable NiMH, custom proprietary design

Battery Life

Approximately 12 hours depending upon backlighting intensity.

Operating Temperature

32° F to 120° F.

If these values are exceeded, battery charge/discharge rates will decline. However, this could be offset by using the power supply. Charging in direct sunlight or near a heat source will not produce a full charge and may permanently damage battery pack.

Storage Temperature

20° F to 158° F. (Instrument and Charger)

Ambient Humidity

10% to 90% non-condensing

Dimensions (See Figure 1)

STX-250-1:	5.00" x 9.55" x 2.23"
STX-500-1 and STX-1000-1:	7.00" x 9.55" x 2.23"
STXM-1000-1:	7.00" x 10.30" x 2.23"
STX-2000-1:	8.48" x 10.30" x 2.23"

Weight

2.3 lb. (depending upon instrument configuration).

Environment

Indoor or outdoor use, dust-free environment.

3. SAFETY AND MAINTENANCE

WARNING: When using cordless, electronic instruments, always follow basic safety precautions to reduce the risk of fire, electric shock and personal injury



USE ONLY A TENSITRON POWER SUPPLY TO AVOID DAMAGE TO INSTRUMENT.



READ AND SAVE ALL INSTRUCTIONS. Before use, ensure all users read and understand this manual, as well as labels packaged with or attached to the instrument.

- Know your instrument. Read this manual carefully to learn your tension meter's applications and limitations, as well as potential hazards associated with this type of instrument.
- Avoid dangerous environments. Do not use your instrument in explosive atmospheres (gaseous fumes, dust or flammable materials). Do not submerge your instrument in liquids.
- Use the right tool or instrument. Do not use this instrument to do a job for which it is not recommended.
- Check for damaged parts. Inspect instrument before use. Check for any binding of moving parts, improper mountings, broken parts and any other condition that may affect operation. Do not use a damaged instrument. Tag damaged instrument "DO NOT USE" until repaired. For repair, send instruments directly to Tensitron.
- Guard against electric shock.
- Maintain instrument carefully. Keep handles dry, clean and free from oil and grease. Do not lubricate. All roller bearings are sealed.
- Do not use instrument if it has received a sharp blow, been dropped or damaged in any way. Do not disassemble. Incorrect reassembly may result in damage to the instrument and risk of electric shock and fire. Return damaged instruments to Tensitron for repair.
- **WARNING:** Only use battery pack assemblies provided by Tensitron with your meter. Other types of batteries might explode, causing personal injury and damage. Unplug charger when not in use.
- Tensitron recommends calibration by the manufacturer at one-year intervals, or sooner if the meter is worn, damaged, or reading incorrectly. However, it is the user's responsibility to establish a suitable calibration interval, considering the user's accuracy requirements, requirements set by contract or regulation, and environmental factors such as frequency and conditions of the meter's use.

4. INSTRUMENT OPTIONS

• Standard Instruments – Using Customer Material

STX-1 series instruments are calibrated specifically to your strapping type(s) and size(s) to ensure the greatest accuracy possible. When ordering, specify: material, width and thickness of the strap.

Model	Range (pounds)	Resolution (pounds)	Full Scale Accuracy
STX-250-1	5-250	0.5	1%
STX-500-1	25-500	1.0	1%
STX-1000-1	50-1000	5.0	1%
STX-2000-1	100-2000	10.0	2%

• Standard Instruments – Using Multiple Materials

STXM-1 series instruments include multiple selections for different strapping. Models STXM-250-1 through STXM-1000-1 includes multiple selections for Poly and PET strappings. The Model: STXM-2000-1 includes selections for both Steel, Poly and PET strappings.

STXM-250-1	5-250	0.5	3%
STXM-500-1	25-500	1.0	3.5%
STXM-1000-1	50-1000	5.0	4%
STXM-2000-1	100-2000	10.0	4%

• Add-On Options

Instruments can be configured with either of these options:

- **- A Analog Output option**

Data output at 40 Hz.

0-5 VDC or 4-20 mA with Software-definable ending sequences.

Provided with 10' strap to interface with your receiving device.

- **- E RS-232 Serial Output option**

Select data sampling rate from 1, 2 or 5 Hz.

Provided with 10' strap to interface with your receiving device.

• Features of all Instruments

- Color graphic display:
 - Large and easy to read, with adjustable backlighting.
 - Shows Tension, Battery Charge Level, and Strap Material and Size Selected.
 - Includes user-definable tension set points.
- Data Statistics: Monitor your process by viewing count, average, minimum/maximum, and standard deviation values of your logged data.
- Selectable Tension Units: Choose to display tension in Lb, Kg or daN.
- Up to ten calibrations can be programmed into the instrument. (Password-protected to provide due diligence against unauthorized changes.)
- Adjustable LCD refresh rates allow for stable digital readings.
- Automatic shutoff after several minutes of non-use.
- All models are typically available from stock.
- All models are factory calibrated and ready for use.
- All calibration values are traceable to National Standards.
- Calibration certificate is included.
- Continuous operation while connected to power supply.
- Durable, lightweight carrying case with protective foam inserts included.
(See Figure 2)



Figure 2: Carrying case with instrument, calibration certificate, charger, adapters and operating instructions.

5. BASIC OPERATION

• Charging Instrument Batteries

1. ⚠ Use only a Tensitron power supply to avoid damage to instrument.
2. Connect power supply to the instrument. Plug the power supply into a power source with input voltages between 100 – 240 VAC.
3. A full charge of the battery assembly requires several hours of charging.
4. Battery pack assembly cannot be overcharged.
5. Instrument will remain on while connected to its power supply.
6. Battery charge level is indicated in upper, right-hand corner of display.

• Quick Start Instructions

1. Power unit on by pressing ON button. Main display will indicate: Tension, Material, Min and Max readings and other information. (See Figure 3.)
2. Select a screen:
 - a. Move between screens by using the up (↑) and down (↓) buttons.
 - b. Make or enter a selection by pressing the Enter/Zero button.
 - c. Exit a setting by pressing the Escape (ESC) button.



Instrument Operation Panel

Main Display

Operation Buttons:
Off / Escape
On / Enter / Zero
Arrow Up
Arrow Down



Main Display

Battery Charge Level

Selectable Units in Kg, daN, Lbs.


Set Point Display

Select Strap Size – Instrument automatically adjusts calibration

Store and Display Max and Min Tension Readings.

Figure 3: Instrument Operation Panel and Display

3. Log Data:
 - a. Press the STORE button to store tension readings along with the Minimum and Maximum of these values.
 - b. Clear the data displayed on the Main Screen by pressing and holding the STORE button, or power the instrument off.
 - c. For additional information on logging and viewing data, refer to Sec 6 Display Screens - Data Logging.
4. Read Tension: Variations in strapping (material, thickness and width) affect tension readings. It is essential to select the correct material and size before use, or tension values may be incorrect.
5. Select Tension Units:
 - a. Using the up or down arrows, scroll to TENSION UNITS, then press ENTER.
 - b. Next, select from: Kilograms, DecaNewtons, or LBS, and then press ENTER.
6. Select Material:
 - a. Using the up or down arrows, scroll to SELECT MATERIAL, then press ENTER.
 - b. Next scroll through the strap descriptions until the correct strap size/material is highlighted, then press ENTER. Your main display will indicate the strap size selected. (See Figure 4)
 - c. If your specific material is not listed, add it to the menu by following the calibration instructions included at the end of these instructions. Or, send a 10' sample of your material/strap and the instrument to Tensitron and ask to have it added to the menu.

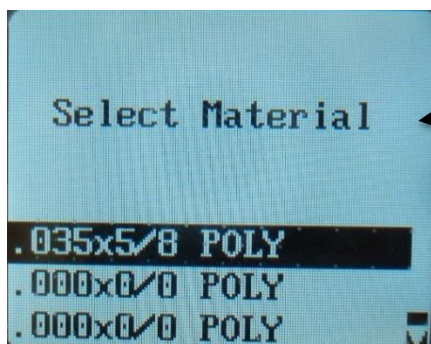

Select strap size –
Instrument automatically
adjusts calibration

Figure 4:
Select Material Screen

7. Zero Instrument: Hold the instrument in the attitude your reading will be taken before you engage it to the tensioned strap. Then, press ZERO.

• Engaging Instrument onto Strap

- To engage the instrument onto the tensioned strap, slip or guide the instrument's three contact elements onto the strap. The proper routing of the strapping is under the two outer guide (or contact) pins, and over center contact element (sensor). **Do not exceed the maximum tension range of the instrument or damage will occur.** (See Figure 5)
- Note the tension reading on the display. (See Figure 5)



Note the routing of the strap (under the outer guide pins and over the center element) and the tension reading on the display.

Figure 5: Instrument ready to engage onto strapping.

6. DISPLAY SCREENS

• **SETUP Screen**

○ **LCD Refresh Rate**

To either speed up or slow down the instrument's LCD refresh rates:

- Scroll to SETUP and press ENTER.
- Scroll to LCD REFRESH RATE and press ENTER.
- Select your preference: 1, 2 or 5 Hz and press ENTER.

Note: This feature is unrelated to Data Averaging

○ **Data Averaging**


Note: This feature is primarily used in processes where the material to be checked is constantly moving, such as coil winding, and textiles, and likely does not apply to use on strapping.

○ **Custom Names**

Custom calibrations, listed as Custom 0 – 9, can be renamed so your material appears as a selection on the Main Display. To rename a Custom Calibration:

- Scroll to SETUP and press ENTER.

- Scroll to CUSTOM NAMES and press ENTER.
 - Scroll to the description to rename and press ENTER.
 - Input your custom name by using the up and down arrows to select each number, letter, or character, followed each time by ENTER.
 - Continue pressing ENTER until all spaces in the description have values, including blank spaces.
 - Once your new name has been entered you will automatically be returned to the SETUP screen.
- **Re-Cal Tension: See description at the end of this booklet.**
- ONLY PERFORM THIS IF YOU ARE A QUALIFIED CALIBRATION HOUSE USING NIST-CERTIFIED CALIBRATION WEIGHTS. NOT USED FOR CHECKING ACCURACY. TO CHECK ACCURACY, REFER TO SEC. 7: CHECK ACCURACY.
- **Audio**
- To turn the Beep ON or OFF:
- Scroll to SETUP and press ENTER.
 - Scroll to AUDIO and press ENTER.
 - Select ON or OFF and press ENTER.
- **Backlight**
- To adjust the visual intensity of the LCD screen.
- Scroll to SETUP and press ENTER.
 - Scroll to BACKLIGHT and press ENTER
 - Select Low, Medium or Full intensity and press ENTER.
- **Set-Point Menu**
- This feature displays tension as a colored bar on the main display. The colored bar advances as tension increases, and retracts as tension decreases. You can define a safe operating tension range. For tension measurements within this range, the bar is green. Below the range, the bar is amber. Above the range, the bar is red.
- To adjust the Set Point Menu:
- Scroll to SETUP and press ENTER.
 - Scroll to SETPOINT MENU and press ENTER.
 - Follow and enter the prompts to turn this feature on or off, or to edit your high and low values. (See Figure 6)

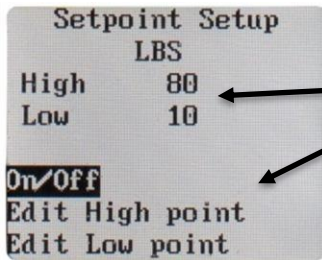

Set Point Setup Screen

See High and Low threshold values
Settings:

- On / Off
- Edit High Point Threshold
- Edit High Point Threshold

Figure 6: Setpoint Setup

○ Version

Press this button to determine what Model the instrument is set at in the firmware as well as to see what level of firmware is downloaded to the Instrument.

• **DATA LOGGING Screen**

Each time the instrument's STORE button is pressed, a log of that strap tension will be stored into memory for later review.

○ View Data Stats

This feature allows the operator to view the basis statistics of the logged data (Count, Average, Minimum/Maximum, and Standard Deviation).

○ View Data Log

When data is logged to the instrument memory, that data and the statistics of that data log (Count, Average, Minimum/Maximum, and Standard Deviation) can be seen under the Data Logging / View Data Stats screen. To view this logged data:

- Scroll to DATA LOGGING and press ENTER.
- Scroll to VIEW DATA LOG and press ENTER.

○ Clear Single Point Log

To clear stored data, scroll to CLEAR SINGLE PT LOG, press ENTER, and follow the prompts.

• **TENSION UNITS Screen**

To change the unit of measure in which tension readings are logged:

- Scroll to Tension Units and press ENTER.
- Use the Up and Down arrows to select Kilograms, DecaNewtons or Pounds and press ENTER.

• **SELECT MATERIAL Screen**

Press ENTER while this display is shown to show the available options for the material types. Use the up or down arrow to scroll to the option you want and press ENTER to select it.

7. ADVANCED OPERATION

• General Calibration Precautions

1. To verify the accuracy of your instrument, check the tension on a sample length of strap by suspending known weights from the opposite end.
2. When performing this test, use a micrometer to measure your strap thickness and ensure it is dimensionally within tolerance.
3. Only use free-hanging weights which are traceable to National Standards on correctly-sized straps. (See Figure 7.)
4. Never use any tensioning device that attempts to convert rotational torque values into tension loads, as these types of systems are highly inaccurate. Also, any load cell system must be routinely checked for accuracy using traceable weights as these types of systems are also highly inaccurate and generally do not meet the minimum repeatable accuracy standards required by ISO-17025.

• Check Accuracy

1. Confirm that the size strap you're working with is the same size selected in your STX's display.
2. Before engaging the STX instrument onto the strap, zero the instrument by holding it in the same attitude you'll be taking the readings and press the "Enter" or "Zero" button. This will eliminate any small tare effects.
3. Take readings along the strap. FOR BEST RESULTS ALWAYS TAKE SEVERAL READINGS OF THE STRAP TENSION BY DISENGAGING AND THEN RE-ENGAGING THE INSTRUMENT FROM THE STRAP ITSELF.
4. Verify the tension value. For example, if your suspended weight is 40.0 lb. your instrument should also indicate 40.0 lb. +/- the full-scale accuracy percentage of the specific instrument model listed in Section 4, once properly engaged to the strap. This procedure confirms the instrument's accuracy and it is now ready for use.

Note: Accuracy Specification: NOTE, ACCURACY IS MODEL DEPENDENT. For an instrument with a full-scale range of 250 lb., this translates into +/- 2.5 lbs, and for an instrument with a full-scale range of 500 lb., accuracy is +/- 5.0 Lbs.(With a 1% Accuracy Specification)

If you have additional questions, please contact Tensitron for help.

• Calibrate Instrument

*IMPORTANT: THIS FEATURE SHOULD ONLY BE USED BY A CALIBRATION FACILITY USING CERTIFIED AND TRACEABLE DEAD WEIGHTS. DO NOT USE THIS FEATURE FOR A SIMPLE ACCURACY CHECK.

If you want to verify or check the accuracy of a Strap go to: "Check Accuracy" in Section 7: Advanced Operation.

When calibrating these instruments tension values must be entered in Lbs. Note: If your dead weight standards are in Kilograms, convert their values into Lbs: 1 KG = 2.2046 Lbs



**Figure 7: Free hanging weight
simulating strap tension.**

Follow these instructions to update the calibration for an existing strap on the menu or to add a calibration for a new strap. If you would like to add a new strap, first create a name for it by following the instructions under “Custom Names” in Section 6, above.


1. Scroll to **SETUP** and press ENTER. Next, scroll to **RE-CAL TENSION** and press ENTER. The screen will now display: **SETUP, RE-CALIBRATE TENSION, ENTER PASSWORD, CAL DATA WILL BE LOST!**
2. **Enter Password.** Contact Tensitron at service@tensitron.com for the password.
3. The display now indicates: **SETUP RE-CALIBRATE TENSION** with a list of the calibration names and custom names programmed into the instrument. Scroll to the description you wish to recalibrate, highlight it and then press **ENTER**.

4. The next screen will indicate: **CALIBRATE TENSION, NUMBER OF POINTS.** Using the up and down arrows select the number of calibration points to which you will be tensioning the strap. The minimum is 5 points. Zero is a calibration point already set, so you will need to define a minimum of 4 increasing tension values such as: 50, 100, 150 and 200. If desired you can define more than 5 weight points, with a maximum of 10 points total. If 10 calibration points were selected the entries could look something like this: 10, 20, 30, 40, 50, 60, 70, 80, 90.

5. **ENTER WEIGHT.** After selecting the number of calibration points, you need to define these weight values. Using the up or down arrows select your first tension, or weight calibration point and press **ENTER**. *Do not use 0 (zero) as this value is already programmed into the instrument.* Next, use the up or down arrows to select your **weight 2** value, making sure the value entered is greater than the entry in **weight 1**. Next, select increasing weight values for the additional weight points, without exceeding the maximum tension range of the instrument.

6. **CALIBRATE TENSION.** Next you will calibrate the instrument using the weight values you previously selected. To properly simulate these tensions, suspend a single length of your strap from above and suspend known weights onto the strap in the values you've previously selected, when prompted. (See Figure 7.)

- a. **CALIBRATE TENSION, NUMBER OF POINTS __, ZERO UNIT.**
Without any strap engaged to the instrument, hold it in the attitude you will be taking the reading in and press **ENTER** to calibrate zero weight. Next the display will prompt you to suspend the weight value you previously selected in step 5. If, for example you selected 50 lb. for your first weight value the instrument will indicate: **PLACE WEIGHT 50.**
- b. Suspend the exact weight value from your strap that you've previously selected (In this example it would be 50 lb.)
- c. Next, engage the instrument to your tensioned strap, then press **ENTER** once the reading has stabilized.
- d. Repeat steps b. and c. for the remaining weight points by suspending additional weights onto your strap in the values previously selected and entering these readings.
- e. Once the last weight value is entered, the instrument will return to the **SETUP** menu. Press the **ESCAPE** button to return to the main display.
- f. The main display will now indicate the strap/material description you just finished calibrating. If the material name on the display is not the material you just recalibrated, you have re-programmed the incorrect description. If this happens, you will need to recalibrate both the material indicated on the display along with the material you thought you were calibrating.
- g. After completing a calibration always recheck the values. Refer to "Check Accuracy" in Section 7.

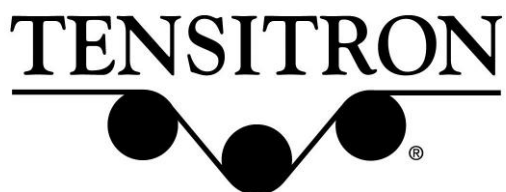

733 S. Bowen Street
Longmont, CO 80501
USA

Phone: (303) 702-1980

Fax: (303) 702-1982

E-mail: sales@tensitron.com

Web Site: www.tensitron.com

